
		OF CEN	UNEVEN TER FO	I CIRCI DR SCHO	UMF(DLARS	U) HOO	DDRON I	HILSON	INTER	RNATIO ISMAN	JAN 86	-	_
UNCLA	SSIFIE		024-85	-C-604	•1					F/G	20/4	ML:	
		Transmit Agrees											
													E)
													, 3.



MICROCOPY RESOLUTION TEST CHART NATIONAL BUREAU OF STANDARDS-1963-A

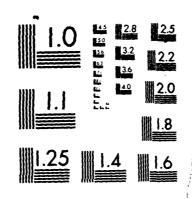

Applied Research Laboratory The Pennsylvania State University

AD-A164 629

THE EFFECTS ON ROTOR NONUNIFORM INFLOW HARMONIC CONTENT OF UNEVEN CIRCUMFERENTIAL DISTRIBUTION OF JET ENGINE INLET GUIDE VANES

by

Margaret R. Hinsman


MTIC FILE COPY



This decument has been approved for public release and sales its distribution in unlimited.

TECHNICAL REPORT

Re 2 2 1 • 7

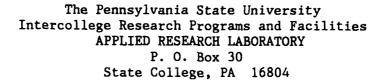

THE EFFECTS ON ROTOR NONUNIFORM INFLOW HARMONIC CONTENT OF UNEVEN CIRCUMFERENTIAL DISTRIBUTION OF JET ENGINE INLET GUIDE VANES

by

Margaret R. Hinsman

Technical Report TR 86-01 January 1986

Supported by: NAVSEA

L. R. Hettche, Director Applied Research Laboratory

Approved for public release; distribution unlimited

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM					
TR-86-01 2. GOVT ACCESSION N	D. 3. RECIPIENT'S CATALOG NUMBER					
VD-77167 V	5. TYPE OF REPORT & PERIOD COVERED					
THE EFFECTS ON ROTOR NONUNIFORM INFLOW HARMONIC CONTENT OF UNEVEN CIRCUMFERENTIAL DISTRIBUTION	3. TYPE OF REPORT & PERIOD COVERED					
OF JET ENGINE INLET GUIDE VANES	6. PERFORMING ORG. REPORT NUMBER					
7 AUTHOR(s)	B. CONTRACT OR GRANT NUMBER(S)					
Margaret R. Hinsman	N00024-85-C-6041					
9. PERFORMING ORGANIZATION NAME AND ADDRESS Applied Research Laboratory P.O. Box 30 State College, PA 16804	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS					
	12. REPORT DATE					
Naval Sea Systems Command, Code 63R31						
Department of the Navy	January 1986 13. NUMBER OF PAGES					
Washington, DC 20362 14 MONITORING AGENCY NAME & ADDRESS/II different from Controlling Offices	15. SECURITY CLASS. (of this report)					
	Unclassified					
	15a. DECLASSIFICATION DOWNGRADING SCHEDULE					
16. DISTRIBUTION STATEMENT (of this Report)						
Approved for public release; distribution unli	nited.					
17 DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different	tom Report)					
18. SUPPLEMENTARY NOTES						
19. KEY MORES (Continue on reverse side if necessary and identify by block numb	er)					
wake field, vane geometry, harmonic content						
A computative parametric study was conducted to investigate the effects of vane section geometry, vane number, and primarily, uneven circumferential vane spacing on the harmonic content of the wake field produced by a row of jet engine Inlet Guide Vanes (IGV). As parameters were varied, the harmonic						
content of the resulting wake field was analyzed unsteady pressures at the rotor. A semi-empiric was used to generate the two-dimensional flow fi	al model is presented which					

		sified FICATION OF	THIS PAGE(H	han Data Ente					
Block	20.	(Cont'd)							
for refactured vanes	educi ring shou	ng unstead	dy press s, relat imized t	ures expe ive to I(o minimiz	erienced GV angula Ze unstead	by the ro r locatio dy pressu	tor. In n, of ever	d not be efact, man enly space	u-
								~ ;	
			•						

Table of Contents

																																	Page
Abstra	ict	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	v
Ac know	vl e	dge	men	t	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	vi
List o	f I	ig	ures	5	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	vii
Nomeno	lat	ur	е.	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•	٠,	viii
INTROE	UCI	rio	N	•	•	•	•	•	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	1
GENERA	TIN	NG	THE	WA	AKE	F	ΊE	LI)		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			2
GENERA	TIN	1G	THE	HA	ARM	ON	IIC	: (CON	VT E	EN.	Γ	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	5
EFFECT	S ()F	VANI	Ε 5	SEC	ΤI	ON	1 (GEC)MF	ETI	RY	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•		5
EFFECT	S ()F	VANI	E i	MUV	BE	R	•	•	•	•	•	•	•	•	•	•			•	•	•	•	•	•	•		•	•	•	•		5
EFFECT	cs (OF	VANI	Ε :	SPA	CI	NO	;		•	•	•	•		•	•	•	•	•	•	•	•	•	•		•	•	•	•	•	•		6
CONCLU	SIC	ONS	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	•	•	•	•	•			•		•	•		10
Refere	nce	es		•	•	•	•		•	•	•	•	•	•	•	•	•		•		•	•	•	•	•	•	•	•	•	•		•	12
Figure	s			•		•					•	•	•		•	•	•			•	•		•	•	•		•		•		•	•	13

Accession For										
NTIS GRA&I										
DTIC TAB										
Unannounced []										
Justi	Justification									
Distribution/ Availability Codes										
}	Avail and	i/or								
Dist	Special									
A-1										

Abstract

A computative parametric study was conducted to investigate the effects of vane section geometry, vane number, and primarily, uneven circumferential vane spacing on the harmonic content of the wake field produced by a row of jet engine Inlet Guide Vanes (IGV). As parameters were varied, the harmonic content of the resulting wake field was analyzed for its potential effect on unsteady pressures at the rotor. A semi-empirical model is presented which was used to generate the two-dimensional flow field downstream of the IGV plane. Results show that uneven angular spacing of IGV should not be employed for reducing unsteady pressures experienced by the rotor. In fact, manufacturing tolerances, relative to IGV angular location, of evenly spaced vanes should be minimized to minimize unsteady pressures.

Acknowledgements

The author would like to express her sincere appreciation to Dr. Donald E. Thompson for his guidance and patience.

This research was funded by the Applied Research Laboratory George F. Wislicenus Undergraduate Research Assistantship under contract with NAVSEA.

List of Figures

Figure	No. Title		Page
1	Schematic of Flow About an Inf:	inite Cascade	13
2	Effect of Drag Coefficient on 1	Fourier Amplitudes	14
3	Effect of Vane Number on Fourie	er Amplitudes	15
4	A Conventional and Unevenly Spa	aced Set of Inlet Guide Vanes .	16
5	The Effect of Unevenly Spaced Data) B = 15, Deviation = 4.2%	IGV on Fourier Amplitudes (Raw	17
6	The Effect of Unevenly Spaced B = 15, Deviation = 4.2%	IGV on Fourier Amplitudes	18
7	The Effect of Unevenly Spaced B = 15, Deviation = 8.3%	IGV on Fourier Amplitudes	19
8	The Effect of Unevenly Spaced B = 15, Deviation = 12.5%	IGV on Fourier Amplitudes	20
9	The Effect of Unevenly Spaced $B = 10$, Deviation = 4.2%		21
10	The Effect of Unevenly Spaced B = 10, Deviation = 8.3%		22
11	The Effect of Unevenly Spaced B = 10, Deviation = 12.5%	IGV on Fourier Amplitudes	23
12	The Effect of Unevenly Spaced B = 5, Deviation = 4.2%		24
13	The Effect of Unevenly Spaced B = 5, Deviation = 8.3%	IGV on Fourier Amplitudes	25
14	The Effect of Unevenly Spaced B = 5, Deviation = 12.5%	IGV on Fourier Amplitudes	26
15	Fourier Amplitudes at Relative Percent Deviations		27
16	The Effect of Manufacturing To: $B = 15$, $\Delta \theta = .5$ degree	lerances on Fourier Amplitudes	28
17	The Effect of Manufacturing To $B = 10$, $\Delta 0 = .5$ degree	lerances on Fourier Amplitudes	29
18	The Effect of Unevenly Spaced $B = 15$, $\Delta O = .5$ degree	IGV on Fourier Phase Angles	30

Nomenclature

A_{O}	Fourier cosine amplitude of the zeroeth harmonic								
AN	Fourier cosine amplitude of the Nth harmonic								
В	number of inlet guide vanes								
B_{N}	Fourier sine amplitude of the Nth harmonic								
С	vane section semichord								
c_D	vane section drag coefficient								
c_N	Fourier modulus								
D	percent deviation of unevenly spaced IGV from evenly spaced IGV								
m	positive integer								
n	summing index								
N	harmonic order								
r	radial coordinate								
u_c	wake centerline velocity								
u _t	resultant wake field velocity								
v	vane section inlet relative velocity								
x	axial coordinate when $\alpha = 0$								
Y	wake halfwidth								
α	vane section stagger angle								
θ	tangential coordinate								
0	angular spacing between evenly spaced vanes								
$c_{\mathbf{i}}$	angular spacing between unevenly spaced vanes								
ΔΟ	maximum difference between vane spacing of unevenly spaced IGV from evenly spaced IGV of the same vane number								
ΦN	Fourier phase angle of the Nth harmonic								

INTRODUCTION

A jet engine rotor blade when operating in a spatially varying flow field will experience unsteady pressures due to the ingested nonuniform velocity field. Markedly increased levels of structural vibration, blade fatigue, and radiated sound result from unsteady forces and moments produced by the unsteady pressures. A Fourier transform of the unsteady inflow to the rotor yields valuable information about the unsteady forces and moments likely to be experienced by the rotor, as they are functions of the inflow harmonic content.

The spatial variation in a flow field of a jet engine rotor is heavily influenced by upstream appendages. The viscous wakes shed by a row of inlet guide vanes (IGV) produce a fertile nonuniform flow field for unsteady forces and moments. A conventional IGV configuration, in which the angular spacing of the vanes is even circumferentially, produces a periodic nonuniform flow field in which the rotor operates. Fourier analysis of this flow field yields prominant Fourier amplitudes at harmonics equal to the number of IGV and multiples, implying energy concentrations at these wave numbers. A rotor operating in this flow field will experience unsteady pressures, proportional to Fourier amplitudes and a function of harmonic phase, at all frequencies. Summation of these unsteady pressures over the blade span and chord and then over all blades results in unsteady forces and moments at frequencies equal to blade number times rotor RPS and multiples. Magnitudes of these forces and moments are proportional to inflow Fourier amplitude and a function of inflow harmonic phase at harmonics equal to number of rotor blades and multiples.

The primary objective of the present investigation was to determine the effects of altering the harmonic content of the rotor inflow by employing

unevenly spaced IGV. Examination of the harmonic content was intended to provide answers to the following questions:

- 1) Is altering the harmonic content of the rotor inflow in this manner beneficial relative to reducing unsteady pressures experienced at the rotor?
- 2) If not, then what effect do manufacturing tolerances have on harmonic content of the rotor inflow produced by conventional IGV configurations, as perfectly even vane spacing in reality is impossible?

Shahady, et al., [1] performed a similar study on effects of uneven rotor blade spacing on radiated sound pressure level and rotor performance. While they found that uneven rotor blade spacing reduces peak amplitudes of the rotor harmonics, the dynamics problem of an asymmetrically weighted rotor could be circumvented if uneven IGV spacing achieves similar results.

A computative parametric study was conducted to investigate the effect of vane section geometry, vane number, and primarily the circumferential vane spacing on the harmonic content of the wake field produced by a row of IGV. A semi-empirical method is presented which was used to generate the two-dimensional flow field downstream of the IGV plane. As parameters were varied, analysis of the harmonic content of the resulting nonuniform flow field yielded a judicious recommendation for IGV configuration to minimize unsteady pressures experienced by the rotor.

GENERATING THE WAKE FIELD

The computational model adopted in this study for generating the viscous wakes of the IGV was developed by Sears and Kemp [2] with the aid of empirical relationships developed by Silverstein, Katzoff, and Bullivant [2], who experimentally measured isolated airfoil wakes and generalized their results.

Sears and Kemp, assuming that the wakes behind each vane are identical to that behind an isolated airfoil, used the results of reference [3] to develop a set of equations which completely defines the viscous wake field generated by an infinite cascade of vanes.

The adopted model can be clarified with a schematic of an infinite cascade (Figure 1). Each vane is of chord 2c, stagger angle α , and angular spacing 0 from adjacent vanes. A viscous wake, of width 2Y and centerline velocity u_c , forms behind each vane as the fluid flows with relative inlet velocity V over the vanes. Thin airfoils with zero camber have been assumed. Sears and Kemp further assumed that the wakes are inviscid, symmetric shear perturbations in the otherwise uniform flow. These perturbations appear as symmetric velocity deficits in the velocity field shown downstream of the cascade.

The model derived in reference [1] can be summarized by three equations. The first defines the wake half-width as a function of x, developed by Silverstein, Katzoff, and Bullivant:

$$Y = .68 \sqrt{2} c[C_D(x-.7c)/c]^{1/2}$$
 (1)

where C_D is the section drag coefficient and x is the distance measured from the trailing edge of the vane along the wake axis to the point of the desired velocity distribution; note that the x coordinate is oblique to the 9 coordinate if $\alpha = 0$. The second relationship is the centerline velocity as a fraction of inlet relative velocity and a function of x, given in reference [2] in the form:

$$\frac{u_{c}}{V} = -(2.42 \sqrt{c_{D}})/(\frac{x}{c} + .3)$$
 (2)

Finally, assuming that the wake field behind a cascade can be described by superposition of individual airfoil wakes, Sears and Kemp give the total perturbation velocity field as a fraction of centerline velocity and function of x and y, or in cylindrical coordinates, a function of x and θ .

$$\frac{u_{t}}{u_{c}} = \sum_{n=-\infty}^{\infty} \exp \left[-\pi \left(\frac{r \cos \alpha}{Y} \right)^{2} \left(\Theta - \Theta_{i} \right)^{2} \right]$$
(3)

r is the distance between the IGV central axis and the vane section under consideration.

In the present investigation the effects of vane section geometry (C_D) , number (B), and spacing (Θ_1) on the harmonic content of the inflow to a rotor were studied. The given model depends on parameters other than those studied in this investigation, i.e. r, α , c, and x. Throughout this investigation these parameters were kept at the following nondescript values: r = 1.0, $\alpha = 0$ degrees, c = 1.0, x = 2c.

Equations (1), (2), and (3) comprise the model for defining completely the two-dimensional perturbation velocity as a fraction of inlet relative velocity due to the viscous wakes shed from an IGV plane of B vanes. While the many assumptions in the development of the adopted model detract from the accuracy of approximating wake fields, for the purposes of Fourier analysis the appropriate trends of the amplitudes and phase angles with changes in geometric and flow variables are accurately predicted. Because this study is concerned with the trends of the harmonic content of wake fields as parameters are varied over wide ranges, a moderately accurate model, while simple and easily manipulable, is preferred.

GENERATING THE HARMONIC CONTENT

In the present investigation the effects of vane section geometry (C_D) , number (B), and spacing (Θ_i) on the harmonic content of the inflow to a rotor were studied. As each parameter was varied, a circumferential axial velocity distribution was generated according to the given model and subsequently expressed as an infinite sum of weighted sinusoids in the familiar form:

$$\frac{\mathbf{u}_{t}}{\mathbf{v}} = \frac{1}{2} A_{0} + \sum_{N=1}^{\infty} \left[A_{N} \cos(N\theta + \phi_{N}) + B_{N} \sin(N\theta + \phi_{N}) \right]$$
 (4)

where $A_{\rm O},~A_{\rm N},$ and $B_{\rm N}$ are defined in the normal way. The Fourier modulus $C_{\rm N}$ and phase $\phi_{\rm N},$

$$C_{N} = \left[A_{N}^{2} + B_{N}^{2}\right]^{1/2} \tag{5}$$

$$\phi_{\rm N} = \tan^{-1} \left(\frac{B_{\rm N}}{A_{\rm N}} \right) \tag{6}$$

completely describe the harmonic content of the flow field. In observance of the Nyquist criterion, harmonic content of up to wave number thirty (30) was analyzed and is presented. This range will be shown to be sufficient for the development of the desired trends in the harmonic content. As harmonic phase is not a function of vane section geometry or the vane number, only the effects on Fourier amplitudes of vane section geometry and vane number are presented.

EFFECTS OF VANE SECTION GEOMETRY

The effect of vane geometry on the Fourier amplitudes of the wake field was studied collectively in terms of the section drag coefficient $C_{\rm D}$. With uniform vane spacing and constant vane number at an arbitrary value of B=5,

the drag coefficient was varied through a range .004 to .02, incorporating a wide variety of airfoil sections and flows of a variety of Reynolds numbers.

Wake fields were generated at vane drag coefficients .004, .012, and .02 and Fourier analyzed (Figure 2), marking the minimum, middle, and maximum $C_{\rm D}$ of the given range. Because equal vane spacing creates periodic velocity deficits, significant Fourier amplitudes occur at harmonics equal to vane number and multiples (N=mB). All other harmonics (N \neq mB) theoretically have Fourier amplitudes of zero. Figure 2 shows that as drag coefficient increases, the resulting larger wake size causes an increase in the amplitudes that define the velocity distribution. The growth of Fourier amplitude is seen to be directly proportional to change in drag coefficient with a proportionality constant of approximately one.

EFFECTS OF VANE NUMBER

The effect of vane number on the Fourier amplitudes of the wake field was studied through the range B=5, 15, and 30, with constant drag coefficient and even vane spacing. Thirty vanes were chosen as the upper limit for B because of the unlikelihood that the adopted model can accurately predict the wake interactions of vanes with closer spacing. As indicated in Figure 3, an increase in the number of evenly spaced IGV reduces the occurance of large Fourier amplitudes in a given wave number range. However, the energy concentration at harmonics equal to vane number and multiple (N=mB) increases as B increases. The growth of Fourier amplitude with increasing vane number is seen to decrease as B increases.

EFFECTS OF VANE SPACING

Determination of the effect of uneven IGV spacing on the harmonic content of the inflow to a rotor was approached in the following manner: Figure 4

shows a conventional IGV configuration and an arbitrary, circumferentially uneven IGV configuration of the same vane number. If ΔO represents the maximum amount by which any of the $\Theta_{\bf i}$ of an arbitrary configuration differs from Θ of a conventional configuration of the same vane number then the percent deviation of the uneven configuration from the conventional is

$$D = (\Delta\Theta/\Theta) \times 100\% \tag{7}$$

Because of the infinite uneven IGV configurations for any one vane number, the effect of an uneven configuration on the harmonic content of the inflow to a rotor was not studied by the individual configuration, as with the previous two parameters, but were categorized by D, percent deviation from the conventional configuration.

Vane numbers 15, 10, and 5 were studied at identical percents of deviation (D) from conventional spacing of 4.2%, 8.3%, and 12.5%. To simplify discussion, consider first the 15-vaned configuration, whose conventional angular spacing is 24 degrees. A deviation of 4.2% corresponds to a $\Delta \Theta$ of 1 degree for 15 vanes. A particular category of unevenly spaced vane configurations has $\Theta_{\bf i}$ in the range

$$(\Theta - \Delta\Theta) \leq O_{\mathbf{i}} \leq (O + \Delta\Theta) \tag{8}$$

Therefore, at 15 vanes and D=4.2%, the range is

(23 deg)
$$\leq c_i \leq$$
 (25 deg)

Even within this range many uneven configurations of $\Theta_{\bf i}$ exist. In order to represent any B,D combination adequately, thirty arbitrary configurations of random vane spacing were generated with the imposed conditions that $\Theta_{\bf i}$ falls within the given range and that at least one of the $\Theta_{\bf i}$'s of each configuration

is the maximum deviation, $(0 \pm \Delta \theta)$. The harmonic content of each of the thirty resulting wake distributions for a given B,D combination was studied collectively to determine trends, if any exist, as the vane spacing became more uneven, in other words, as D increased. This procedure was followed for each of the vane numbers.

Figure 5 gives the Fourier amplitudes of the case described above, B=15 and $\Delta\theta$ = 1 degree. All thirty sets of C_N appear in the plot, giving the probable spread of amplitudes at each harmonic under the given conditions. Data such as that plotted in Figure 5 were obtained for the given D's of the three vane numbers, but subsequent plots of amplitude spread for a given vane number and $\Delta\theta$ have been reduced to an average amplitude bound by the addition and subtraction of one standard deviation (see Figure 6 for the reduction of Figure 5).

Figures 6-14 give the reduced Fourier amplitude spreads for 15, 10, and 5 vanes, at deviations of 4.2%, 8.3%, and 12.5% in which the appropriate trends of the effect of uneven IGV spacing on the Fourier amplitudes have developed. These figures show that even the smallest angle deviation, Δ0 =1 degree in Figure 6, will impart to the flow significant Fourier amplitudes at harmonics other than those equal to vane numbers and multiples (N≠mB), while those of harmonics of N=mB do not decrease significantly. Trends show that for each vane number, as Δ0 increases, the amplitudes of the N≠mB harmonics increase, while those at the N=mB harmonics decrease, until the Fourier amplitudes at harmonics N≠mB grow to meet those of harmonics N=mB. This trend is shown best with five vanes in Figures 12, 13 and 15. Thus for a given vane number, the effect of uneven vane spacing as spacing becomes more uneven is to reduce the peak amplitudes of the N=mB harmonics, while raising all other harmonics from theoretically zero to a significant amplitude. Another obvious characteristic

of Figures 6-14 is that between adjacent N=mB harmonics the Fourier amplitudes decrease to a minimum amplitude, at or near the harmonic halfway between, or N=[mB+(m+1)B]/2. As unsteady forces and moments experienced by the rotor are a function of the inflow harmonic content at harmonics of rotor blade number and multiples, choosing a blade number equal to the harmonic of a minimum amplitude would seem to minimize unsteady forces and moments. However, the even multiples of this harmonic correspond to maximum amplitudes.

The average Fourier amplitudes of Figures 6-14 have been combined on a relative harmonic scale in Figure 15. The curves of this figure indicate that for a given percent deviation, the Fourier amplitudes of harmonics N≠mB are similar in magnitude between corresponding peak amplitudes for all vane numbers. Also, as D increases, magnitudes of N≠mB harmonics increase while those of N=mB decrease.

Investigation of the effect of manufacturing tolerances on the harmonic content produced by evenly spaced IGV required study of a .5 degree ΔO , performed with vane numbers 15 and 10 whose Fourier amplitudes appear in Figures 16 and 17. These figures indicate that significantly larger harmonic amplitudes are generated from a conventional IGV configuration than the theoretically zero expected.

The effect of uneven IGV spacing on the Fourier phase angle is shown in Figure 18, in which phase angle is represented on a relative scale as Phase/N. The solid lines connect the maximum possible Phase/N at each harmonic. The net effect of randomly changing the vane spacing is to randomly change the phase at harmonics N≠mB, while those of N=mB remain constant.

CONCLUSIONS

The effects of inlet guide vane section goemetry, number and spacing on the harmonic content of the inflow to a rotor have been studied and presented. The intent of this investigation has been to determine how these three parameters may effect unsteady forces and moments experienced by the rotor, as they are functions of the inflow harmonic content.

The effect of vane section drag coefficient on the Fourier amplitudes of the inflow to a rotor is evident (Figure 2). As drag coefficient increases, wake size increases, resulting in increased Fourier amplitudes. The less the IGV obstruct the inflow to the rotor, the less influence harmonic content due to IGV-flow interactions will have at the rotor. Therefore, IGV size and thickness should be minimized to minimize unsteady pressures at the rotor.

The effect of increasing vane number on Fourier amplitudes is to increase the Fourier amplitudes of the N=mB harmonics but decrease the occurrance of these significant amplitudes in a given wave number range. Figure 15 shows that the Fourier amplitudes of the N≠mB harmonics for different vane number and equal percent deviation are of similar magnitudes.

As shown in Figures 6 through 18, altering the harmonic content of the inflow to a rotor by employing unevenly spaced IGV adversely affects unsteady pressures experienced by the rotor. Fourier amplitudes at all harmonics are significant when angular deviations as small as .5 degree from even spacing exist (Figures 16, 17). Thus, not only should uneven vane spacing not be employed, but manufacturing tolerances relative to IGV angular position of conventional IGV configurations should be minimized in order to minimize Fourier amplitudes at harmonics N≠mB. Figures 16 and 17 indicate that a manufacturing tolerance of .5 degree will affect unsteady pressures experienced at the rotor significantly more than previously realized. In

addition, Figure 18 indicates that no trends exist in Fourier phase angle of harmonics N \neq mB for a given $\Delta\Theta$ and B. In other words, a $\Delta\Theta$ in IGV angular spacing will cause the Fourier phase to be unpredictable at harmonics N \neq mB unless the precise location of each vane is known.

Finally, information similar to that contained in Figure 15 can be utilized in the design of a jet engine for judicious choice in vane number, blade number, and vane circumferential spacing so as to minimize unsteady forces and moments, and radiated sound from the rotor.

References

- [1] Shahady, etal., "Fan Compressor Noise Reduction," Paper No. 69-GT-9, presented at ASME Gas Turbine Conference, Cleveland, 1968.
- [2] Kemp, N. H. and Sears, W. R., "The Unsteady Forces Due to Viscous Wakes in Turbomachines," Journal of Aeronautical Sciences, Vol. 22, No. 7, July 1955, pp. 478-483.
- [3] Silverstein, A., etal., "Downwash and Wake Behind Plain and Flapped Airfoils, NACA Refs. 651, 1939.



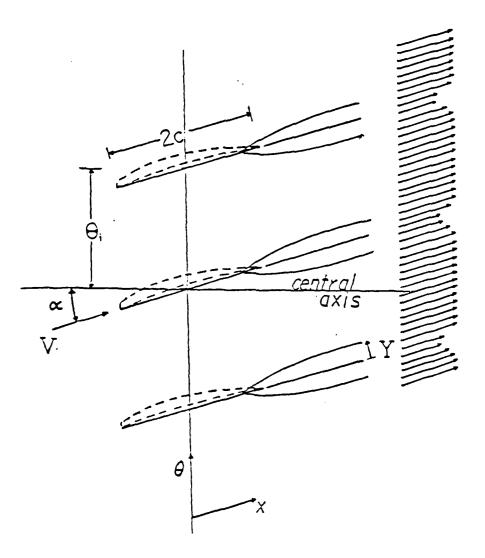



Figure 1. Schematic of Flow About an Infinite Cascade

Effect of Drag Coefficient on Fourier Amplitudes

Figure 2.

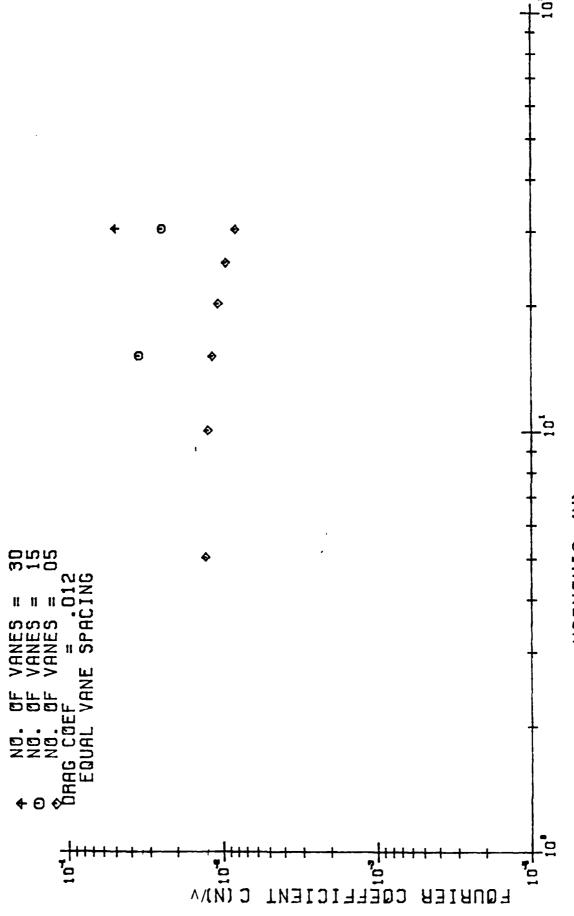

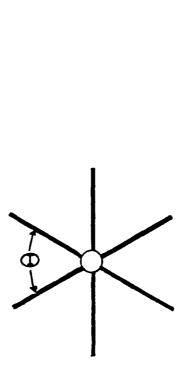

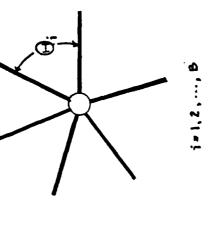

UNEVEN VANE SPACING

EVEN VANE SPACING

Figure 4. A Conventional and Unevenly Spaced Set of Inlet Guide Vanes

Da	
Raw .	
Sa	
6	
4	66 0 0 0 0 0 0
	6 3330 330 0 350 0 9 3330 330 0 3500 0
6	6 53 63 63 6 6 6
	9 5 6 7 7 7 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9
	65.65 65.65 65 65 65 65 65 65 65 65 65 65 65 65 6
page distribution of the second of the secon	ED GED CED CED CED
	(1) (2) (3) (3) (4) (4) (4) (4) (4) (4) (4) (4) (4) (4
2%	9899 999 999 89 22 2
The state of the s	09 - 603030 - 00 667 - 0 - 0 - 0 -
0	69 99 69 9
CN CN CO	ED 60 (88) (89) (87) (87)
The Effect Deviation = 012 PCING DEG	
11 11 00	0 \$300 AD AD AD 0 0 0 0
ν II	
Tgure F ANES VANE	
	6 0-33-33 9 6-37-3 € 6-3
D 000	
La	FOURIER-COEFFICIENT C(N)



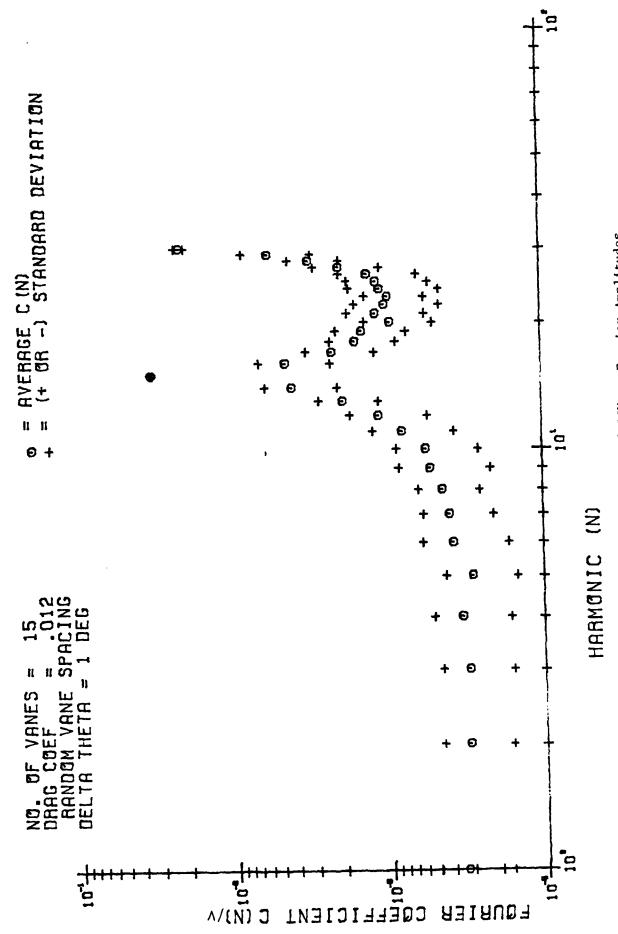


Figure 6. The Effect of Unevenly Spaced IGV on Fourier Amplitudes, Deviation = 4.2%

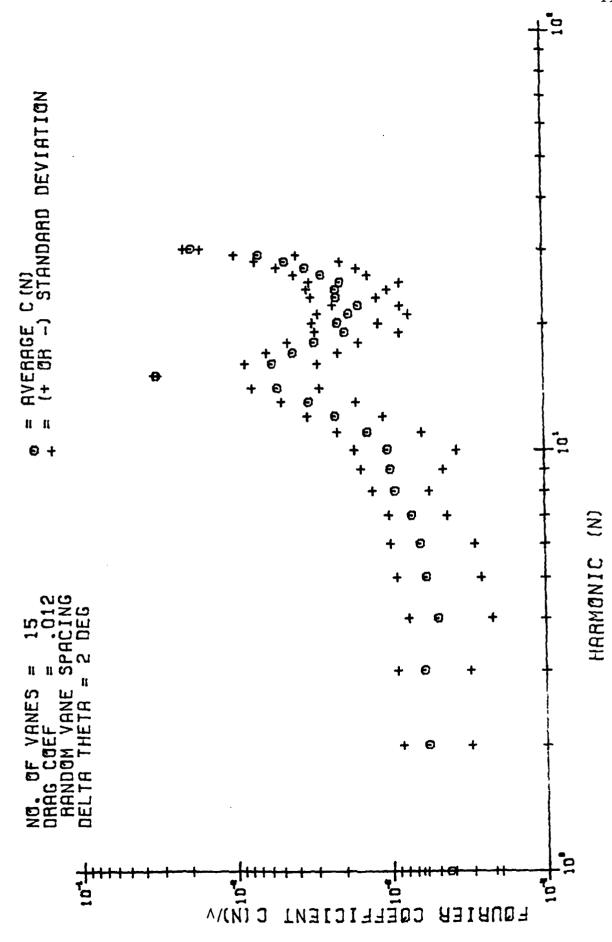


Figure 7. The Effect of Unevenly Spaced IGV on Fourier Amplitudes, Deviation = 8.3%



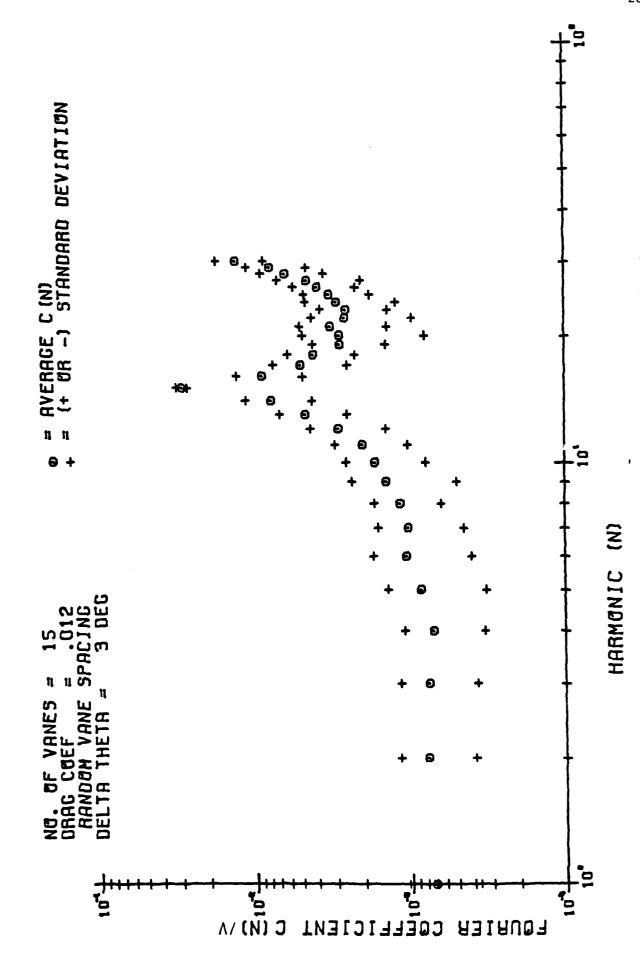


Figure 8. The Effect of Unevenly Spaced IGV on Fourier Amplitudes, $\rho_{\rm CV}$ fation = 12.5%

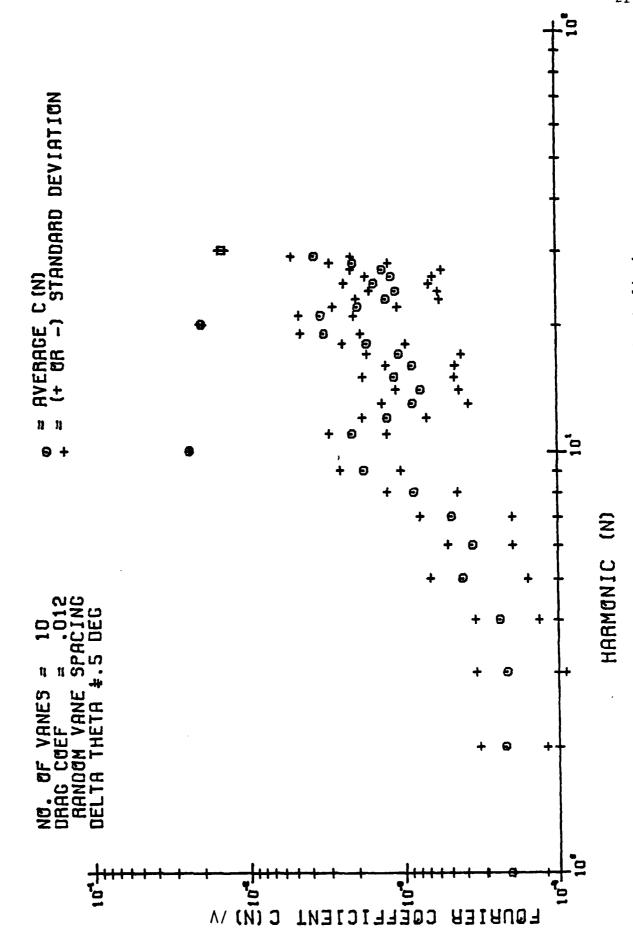


The Effect of Unevenly Spaced IGV on Fourier Amplitudes, Deviation = 4.2%Figure 9.

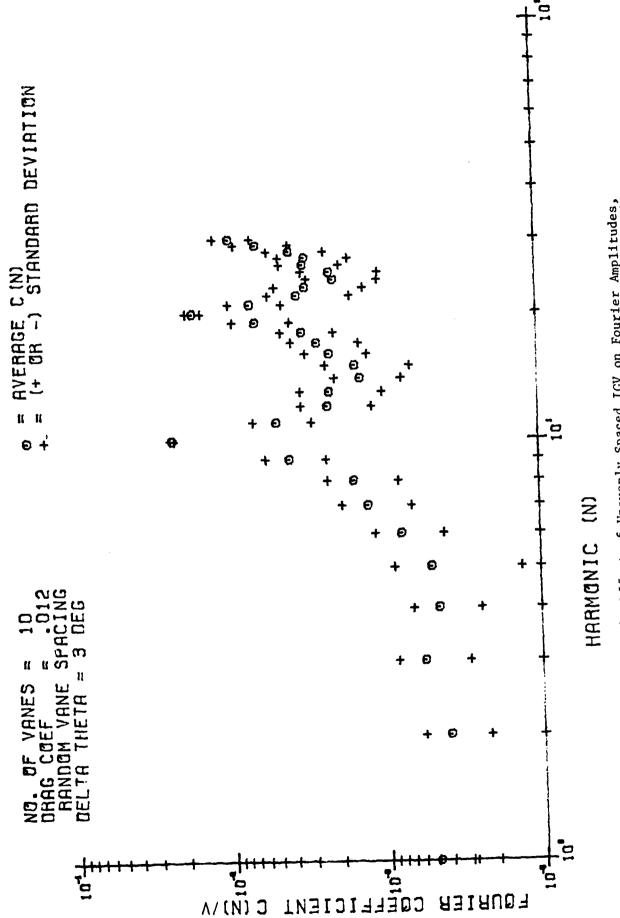

The Effect of Unevenly Spaced IGV on Fourier Amplitudes, Deviation = 8.3%Figure 10.



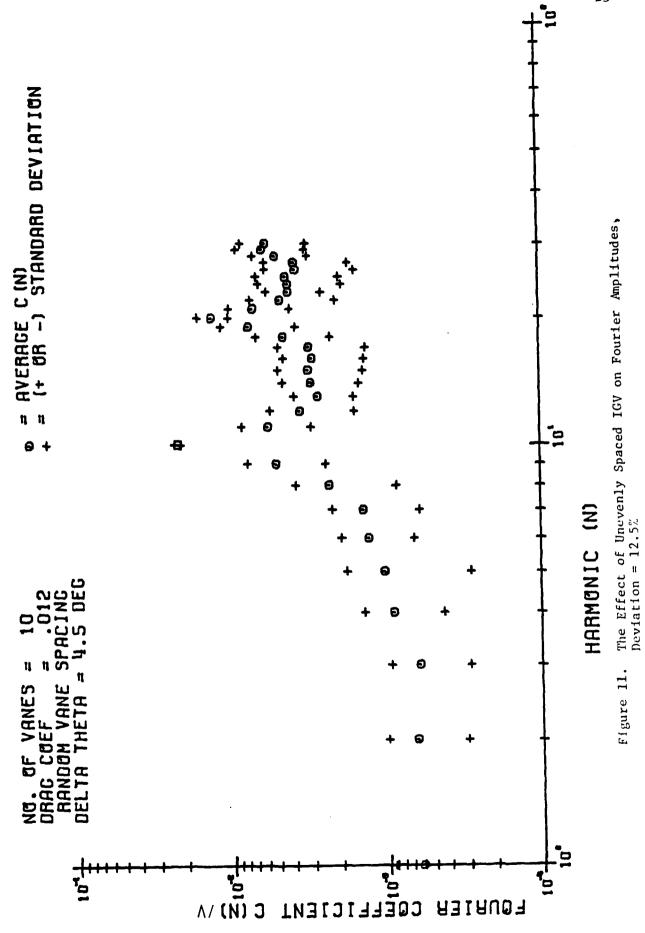

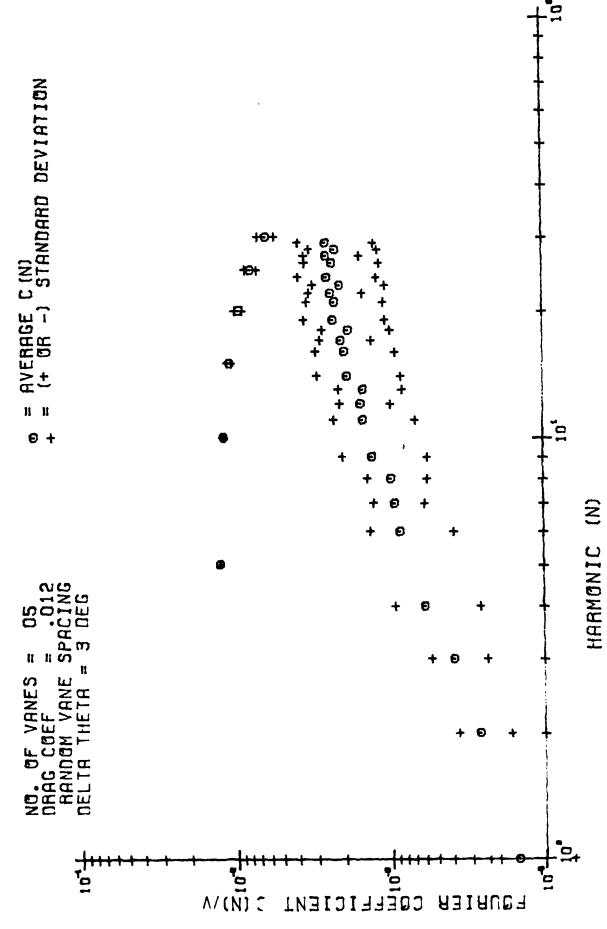
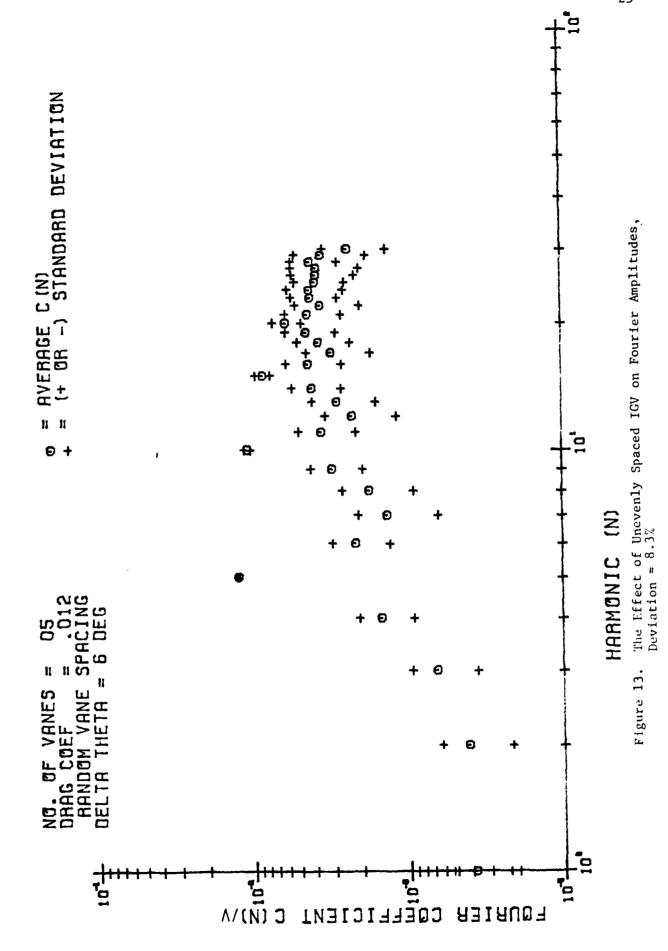
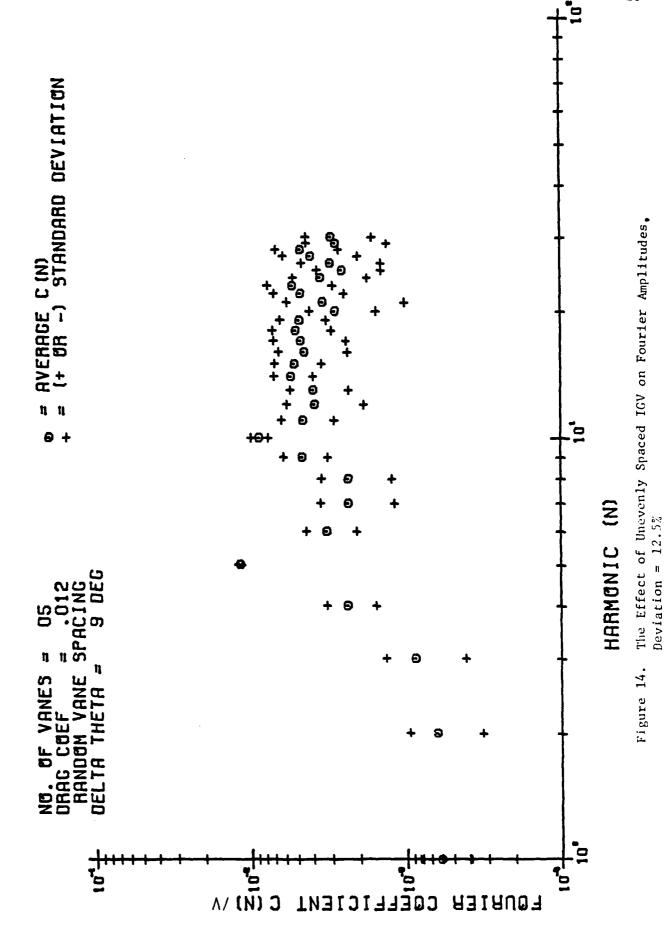


Figure 12. The Effect of Unevenly Spaced ICV on Fourier Amplitudes, Deviation = 4.2%










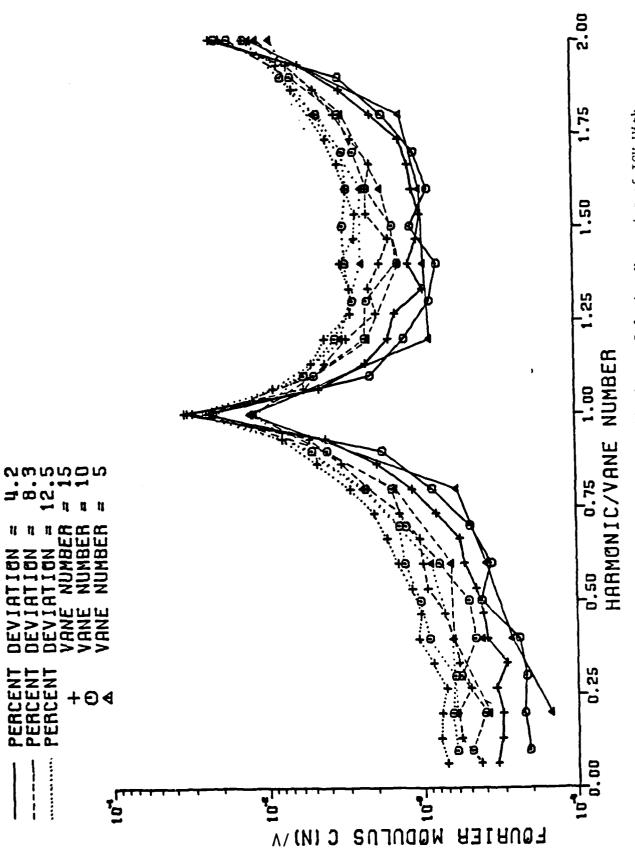


Figure 15. Fourier Amplitudes at Relative Harmonics of IGV With Varying Percent Deviation

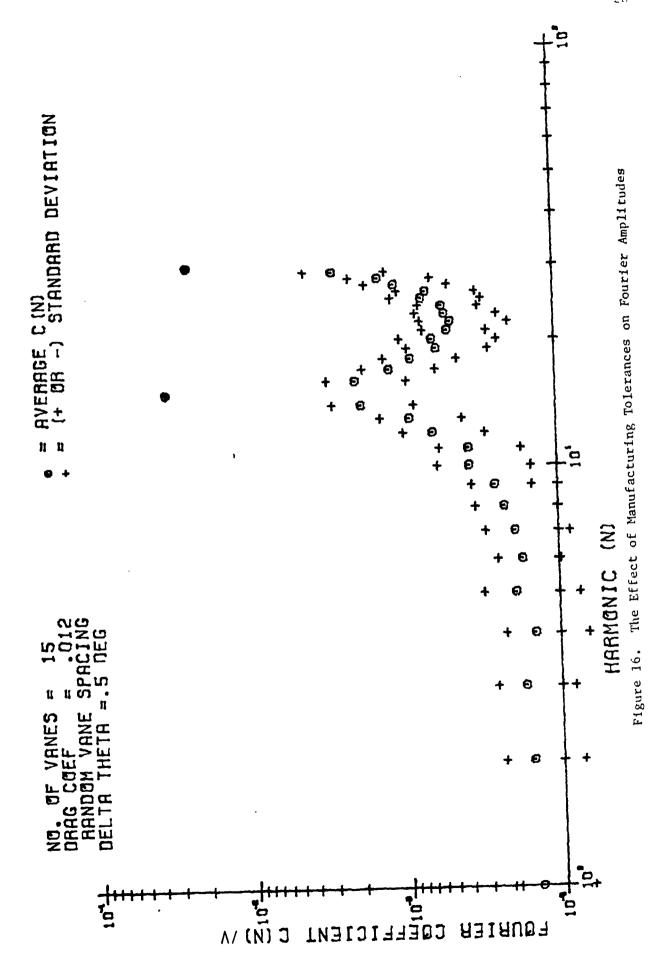

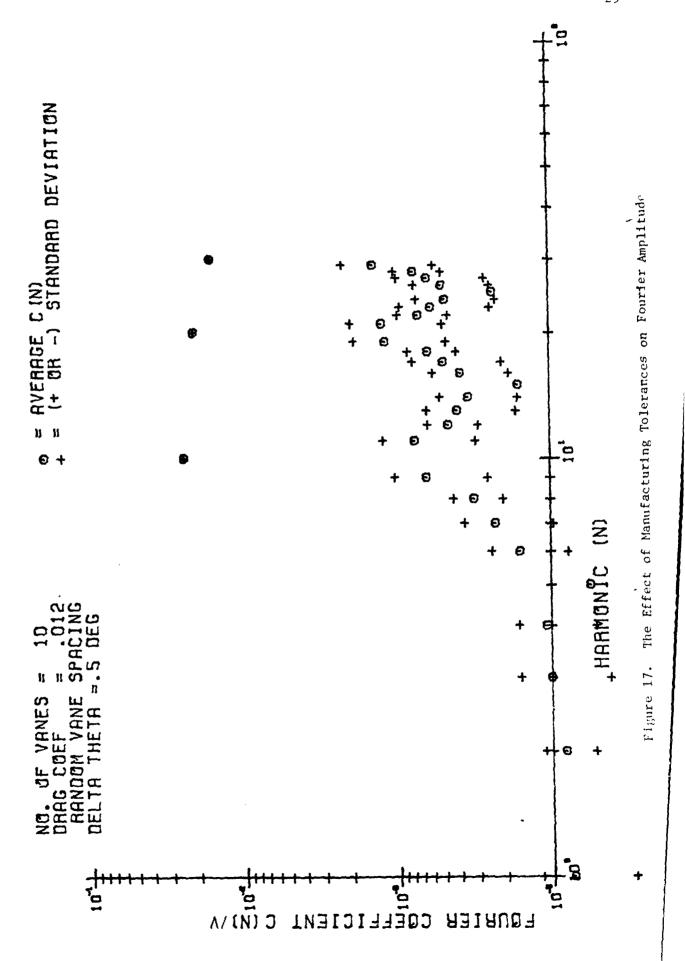

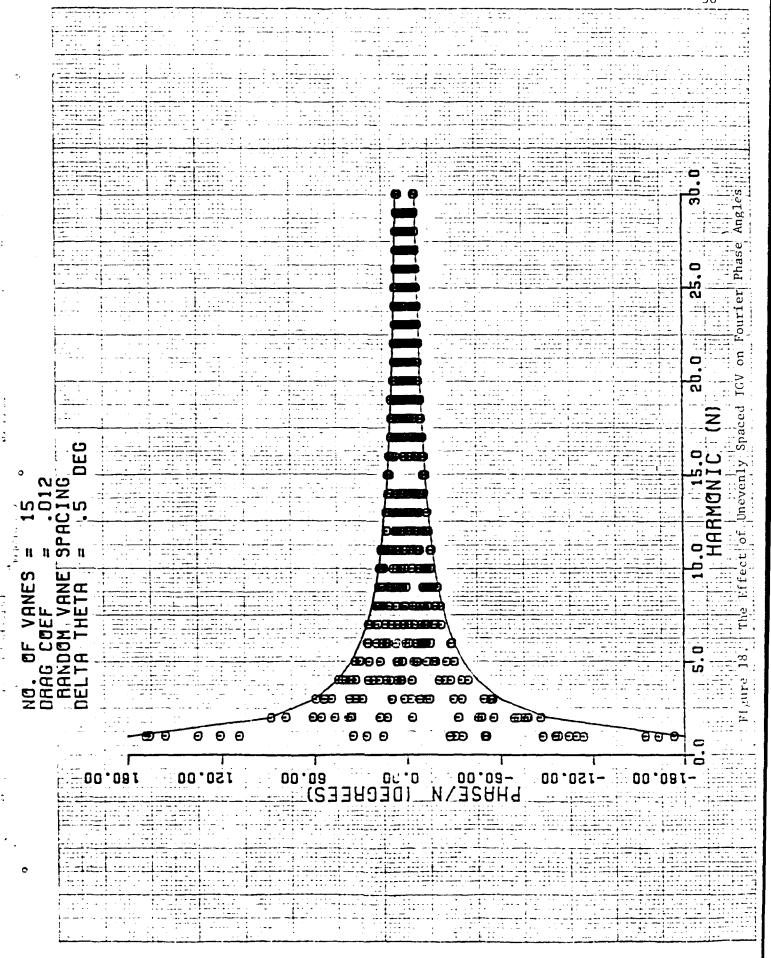

DTIC END) -86